

**DOWEX™ MAC-3 Resin**
Macroporous Weak Acid Cation Exchange Resin

For Water Softening, Dealkalization and Demineralization Applications

Description

DOWEX™ MAC-3 Weak Acid Cation Resin has high exchange capacity, excellent regeneration efficiency, very good resistance to osmotic shock, plus good chemical and physical stability.

DOWEX MAC-3 Resin is effective in removal of temporary hardness (hardness associated with alkalinity) and dealkalization. It can also be used for recovery of metals. DOWEX MAC-3 Resin can be supplied in accordance to the TOC (Total Organic Carbon) requirements of the major European legislations for use in food and potable water applications. In such cases, a recommendation is given for resin conditioning before use.

**Typical Physical
and Chemical
Properties**

Physical Form		White to amber opaque beads
Matrix		Polyacrylic, macroporous
Functional group		Carboxylic acid
Ionic form as shipped		H ⁺ form
Total volume capacity, min.	eq/L kgr/ft ³ as CaCO ₃	3.8 83.0
Particle size† 300–1,200 µm, min. (50 mesh–16 mesh)	%	90
Moisture retention capacity	%	44–52
Whole beads	%	90–100
Total swelling (H ⁺ → Na ⁺)	%	~70
Particle density	g/mL	1.18
Shipping density**	g/L lbs/ft ³	750 47

† For additional particle size information, please refer to Particle Size Distribution Cross Reference Chart (Form No. 177-01775).

**As per the backwashed and settled density of the resin, determined by ASTM D-2187

**Suggested
Operating
Conditions**

Maximum operating temperature	120°C (250°F)
pH range	5–14
Bed depth, min.	800 mm (2.6 ft)
Flow rates: Service/fast rinse Backwash Regeneration/displacement rinse	5–50 m/h (2–20 gpm/ft ²) See figure 1 1–10 m/h HCl (0.4–4 gpm/ft ²) 5–20 m/h H ₂ SO ₄ (2–8 gpm/ft ²) 5–20 m/h (2–8 gpm/ft ²)
Total rinse requirement	3–6 BV*
Regenerant	1–5% HCl or 0.5–0.8% H ₂ SO ₄

*1 BV (Bed Volume) = 1 m³ solution per m³ resin or 7.5 gals per ft³ resin


Packaging

25 liter bags or 5 cubic feet fiber drums

Hydraulic Characteristics

Figure 1 shows the bed expansion of DOWEX™ MAC-3 resin as a function of backwash flow rate and water temperature. Figure 2 shows the pressure drop data for DOWEX MAC-3 as a function of service flow rate and water temperature. Pressure drop data are valid at the start of the service run with clear water and a correctly classified bed.

Figure 1. Backwash Expansion Data

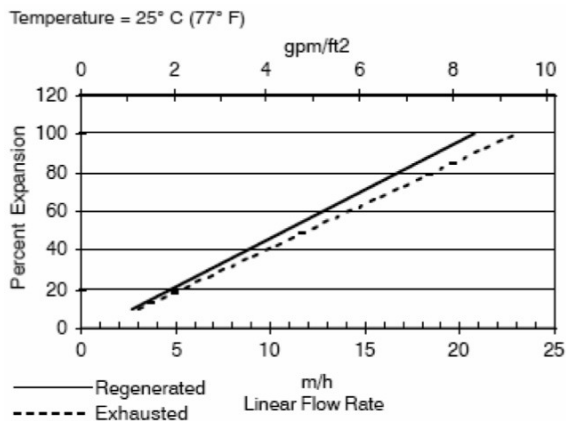


For other temperatures use:

$$F_T = F_{77°F} [1 + 0.008 (T_F - 77)], \text{ where } F \equiv \text{gpm/ft}^2$$

$$F_T = F_{25°C} [1 + 0.008 (1.8T_C - 45)], \text{ where } F \equiv \text{m/h}$$

Figure 2. Pressure Drop Data

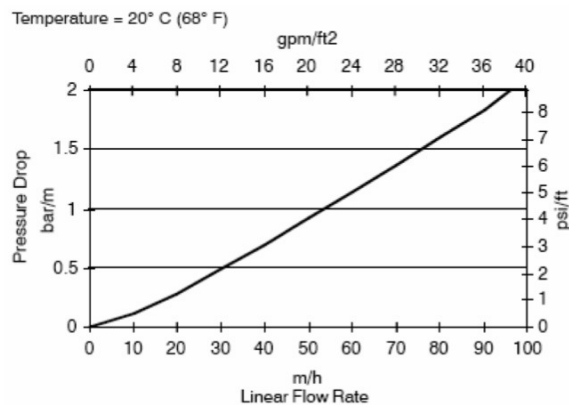

For other temperatures use:

$$P_T = P_{20°C} / (0.026 T_C + 0.48), \text{ where } P \equiv \text{bar/m}$$

$$P_T = P_{68°F} / (0.014 T_F + 0.05), \text{ where } P \equiv \text{psi/ft}$$

Product Stewardship

Dow has a fundamental concern for all who make, distribute, and use its products, and for the environment in which we live. This concern is the basis for our product stewardship philosophy by which we assess the safety, health, and environmental information on our products and then take appropriate steps to protect employee and public health and our environment. The success of our product stewardship program rests with each and every individual involved with Dow products - from the initial concept and research, to manufacture, use, sale, disposal, and recycle of each product.

Customer Notice

Dow strongly encourages its customers to review both their manufacturing processes and their applications of Dow products from the standpoint of human health and environmental quality to ensure that Dow products are not used in ways for which they are not intended or tested. Dow personnel are available to answer your questions and to provide reasonable technical support. Dow product literature, including safety data sheets, should be consulted prior to use of Dow products. Current safety data sheets are available from Dow.

Warning: Oxidizing agents such as nitric acid attack organic ion exchange resins under certain conditions. This could lead to anything from slight resin degradation to a violent exothermic reaction (explosion). Before using strong oxidizing agents, consult sources knowledgeable in handling such materials.

NOTICE: No freedom from infringement of any patent owned by Dow or others is to be inferred. Because use conditions and applicable laws may differ from one location to another and may change with time, Customer is responsible for determining whether products and the information in this document are appropriate for Customer's use and for ensuring that Customer's workplace and disposal practices are in compliance with applicable laws and other government enactments. The product shown in this literature may not be available for sale and/or available in all geographies where Dow is represented. The claims made may not have been approved for use in all countries. Dow assumes no obligation or liability for the information in this document. References to "Dow" or the "Company" mean the Dow legal entity selling the products to Customer unless otherwise expressly noted. NO WARRANTIES ARE GIVEN; ALL IMPLIED WARRANTIES OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE ARE EXPRESSLY EXCLUDED.

